



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D4680-041
Job Sheet 190776



Part No: D4680-041

Job Qty: 2 pcs

Part Name: Skidtube Assembly



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 2/14/19

Job Tracking No:

Due Date: 3/18/19

Created By: Marie Lajeunesse

Type: Stock

Description: S:op

Note: DWG REV F IPP REV:A 13.04.16 NEW ISSUE DD VERF:JLM IPP REV:B 13.08.08 PB2 DD VERF:JLM IPP REV:C 13.09.10 PB3 DD VERF:JLM IPP REV:D 13.11.14 AS PER DWG REV.B DD VERF:JLM IPP REV:C 14.11.24 AS PER DWG REV.C DD VERF:JLM IPP REV:D 15.06.10 AS PER DWG REV.D DD VERF:JLM IPP REV:E 16.03.23 AS PER DWG REV.E DD VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
120	Skidtubes - 1	2 pcs	3/18/19		0.00	9.72	Skidtubes - 1		
							Skidtubes - 2		
							Skidtubes - 3		
							Skidtubes - 4		
							Skidtubes - 5		
140	QC 5	2 pcs	3/18/19		0.00	0.00	QC 5 - 10		PD 19.02.26
							QC 5 - 12		
							QC 5 - 17		
							QC 5 - 18		
							QC 5 - 19		
							QC 5 - 22		
							QC 5 - 24		
							QC 5 - 3		
							QC 5 - 42		
							QC 5 - 43		
							QC 5 - 49		
							QC 5 - 51		
							QC 5 - 58		
							QC 5 - 68		
							QC 5 - 9		
							QC 5 - 50		
							QC 5 - 30		
150	Handfinish - 1-1 Chemical-B4B	2 pcs	3/18/19		0.00	1.46	Handfinish - 1 - 1 - B4B		
							Handfinish - 1 - 2 - B4B		
							Handfinish - 1 - 3 - B4B		
							Handfinish - 1 - 4 - B4B		
							Handfinish - 1 - 5 - B4B		
							Handfinish - 1 - 6 - B4B		
							Handfinish - 1 - 7 - B4B		

Plex 2/14/19 1:28 PM Dart.lajeunesse.marie



Container No: S155382



Part: D4680-041

Job No: 190776

Serial No/Batch: S155382

Revision: F

Inspector:

Exp Date:

Instructions: Various STC's

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL.: 1 613 832-5201
Email: sales@dartaero.com
www.dartaerospace.com

Date: 02/21/19

					Handfinish - 1 - 8 - B4B	
					Handfinish - 1 - 9 - B4B	
					Handfinish - 1 - 10 - B4B	D.R 19/2/26
					Handfinish - 1 - 11 - B4B	
					Handfinish - 1 - 12 - B4B	
					Handfinish - 1 - 13 - B4B	
					Handfinish - 1 - 14 - B4B	
					Handfinish - 1 - 15 - B4B	
					Handfinish - 1 - 16 - B4B	
					Handfinish - 1 - 17 - B4B	
					Handfinish - 1 - 18 - B4B	
					Handfinish - 1 - 19 - B4B	
					Handfinish - 1 - 20 - B4B	
					Handfinish - 1 - 21 - B4B	
					Handfinish - 1 - 22 - B4B	
160 QC 7	2 pcs	3/18/19	0.00 0.00	QC 7 - 10		
				QC 7 - 13		
				QC 7 - 14		
				QC 7 - 15		
				QC 7 - 17		
				QC 7 - 18		
				QC 7 - 19		
				QC 7 - 2		
				QC 7 - 28		
				QC 7 - 3		
				QC 7 - 30		
				QC 7 - 34		
				QC 7 - 36		
				QC 7 - 37		
				QC 7 - 41		
				QC 7 - 47		
				QC 7 - 48		
				QC 7 - 51		
				QC 7 - 58		
				QC 7 - 59		
				QC 7 - 6		
				QC 7 - 60	M60	
				QC 7 - 9		
				QC 7 - 68		
				QC 7 - 50		
				QC 7 - 67		
170 Skidtubes - 2 - B4B	2 pcs	3/18/19	0.00 9.72	Skidtubes - 1 - B4B	DD	
				Skidtubes - 2 - B4B		
				Skidtubes - 3 - B4B		
				Skidtubes - 4 - B4B		
				Skidtubes - 5 - B4B		
180 QC 5	2 pcs	3/18/19	0.00 0.00	QC 5 - 10		
				QC 5 - 12		
					Plex 2/14/19 1:28 PM Dart.lajeunesse.marie	

					QC 5 - 17	
					QC 5 - 18	
					QC 5 - 19	
					QC 5 - 22	
					QC 5 - 24	
					QC 5 - 3	
					QC 5 - 42	
					QC 5 - 43	
					QC 5 - 49	
					QC 5 - 51	
					QC 5 - 58	
					QC 5 - 68	
					QC 5 - 9	
					QC 5 - 50	
					QC 5 - 30	
210	Handfinish - 2-1 Pressure- B4B	2	3/18/19	0.00 1.46	Handfinish - 2 - 1 - B4B	
	pcs				Handfinish - 2 - 2 - B4B	
220	Powdercoat - 1 White Gl(A)- B4B	2	3/18/19	0.00 0.34	Powdercoat - 1 - B4B	
	pcs				Powdercoat - 2 - B4B	
					Powdercoat - 3 - B4B	
					Powdercoat - 4 - B4B	
230	QC 3	2	3/18/19	0.00 0.00	QC 3 - 10	
	pcs				QC 3 - 13	
					QC 3 - 15	
					QC 3 - 17	
					QC 3 - 18	
					QC 3 - 2	
					QC 3 - 26	
					QC 3 - 28	
					QC 3 - 3	
					QC 3 - 30	
					QC 3 - 34	
					QC 3 - 36	
					QC 3 - 41	
					QC 3 - 51	
					QC 3 - 58	
					QC 3 - 59	
					QC 3 - 6	
					QC 3 - 68	
					QC 3 - 9	
260	Handfinish - 4-1-Assembly- B4B	2	3/18/19	0.00 1.46	Handfinish - 4 - 1 - B4B	
	pcs				Handfinish - 4 - 10 - B4B	
					Handfinish - 4 - 11 - B4B	
					Handfinish - 4 - 12 - B4B	
					Handfinish - 4 - 13 - B4B	
					Handfinish - 4 - 14 - B4B	
					Handfinish - 4 - 15 - B4B	
					Handfinish - 4 - 2 - B4B	
					Handfinish - 4 - 3 - B4B	
					Handfinish - 4 - 4 - B4B	
					Handfinish - 4 - 5 - B4B	
					Handfinish - 4 - 6 - B4B	
					Handfinish - 4 - 7 - B4B	
					Handfinish - 4 - 8 - B4B	

DAS
15
9-89

https://www.plexonline.com/77f2ee15-4173-4759-901d-38fd72533163/Plexus_Control/Report_View/2.asp?URL=../Part/Job_Sheet.asp&Report=Tru... 4/5

holes using 0.187" drill. 6-Open ground wire hole .297" at 95.75" (1 at fwd end & 2 at aft end at 20.81" ref.) 8- 3 most fwd x-bolt holes must be laid out manually, open to #30. 9-Open Aft & Fwd Cap holes using .208" drill. 10- Open X-Bolt holes to .750" (10 places) 11- Drill Rivet Holes as per Dwg D4680 using DT10065 ***DO NOT DRILL RIVET HOLES ON SECTION G-G (TWO PLACES) Open G-G to .750 12-Deburr holes.

140 - (QC5- Inspect part completeness to step on W/O)

150 - (Chemical Conversion Coat per QSI005 4.1)

160 - (QC7-Inspect Chemical Conversion Coat)

170 - 1- Bond web as per Dwg D4680 & QSI 015 2- Seal all faying surfaces using proseal and rivet Doubler as per Dwg D4680. A/R Proseal Batch: 5146134 exp date: 10/19 ***LET IT CURE FOR 7HRS*** START TIME: _____ FINISH TIME: _____

3- Rivet doublers as per dwg Shave rivet as required, remove Proseal spill over. 4- Ream holes section C-C as per dwg, deburr 8 places 5- Swage x-bolt spacers as per Dwg D4680 and section C-C 8 places. 6- Swage x-bolt spacer as per dwg D4680 section G-G 7- Trim/Grind flush per QSI 002

180 - (QC5- Inspect part completeness to step on W/O)

210 - (Pressure Wash per QSI005 4.3/ Clean and remove all markings), Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.

220 - (White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum), START TIME: _____

230 - (QC3- Inspect Part Finish)

260 - (Assemble as per dwg), 1- Install Ground Wire inserts as per Dwg D4680. 2-Inspect for Foreign objects 3- Install Fwd & Aft caps as per Dwg D4680 and Detail "A" & "B". Fastener must be install wet as per note (9). Seal all faying surfaces note (8) A/R 241 Sika Flex Batch: 5139855 Exp Date: 19-7 4- Wing Walk as per Dwg D4680 and QSI 005 4.4 Batch: 514610d

270 - (QC5- Inspect part completeness to step on W/O)

300 - (Identify as per dwg & Stock Location: _____)

310 - (QC21- Final Inspection - Work Order Release)

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D4680-041-BENT	Extrusion Bent	2 pcs (1 ea)	120-Skidtubes - 1	5108686
D5520-1	Doubler	4 pcs (2 ea)	120-Skidtubes - 1	5146905
CR3212-5-05	Rivet	136 pcs (68 ea)	170-Skidtubes - 2 - B4B	5117005
D4681-041	Web Assembly	2 pcs (1 ea)	170-Skidtubes - 2 - B4B	5084645
AELS-1032-130	Rivnut	6 Ea (3 ea)	260-Handfinish - 4-1-Assembly-B4B	5152720
AN3C4A	Bolt	6 Ea (3 ea)	260-Handfinish - 4-1-Assembly-B4B	5152638
AN3C5A	Bolt	4 Ea (2 ea)	260-Handfinish - 4-1-Assembly-B4B	5075999
AN526C1032R10	Screw	4 Ea (2 ea)	260-Handfinish - 4-1-Assembly-B4B	507166d
D2965	Cap	2 pcs (1 ea)	260-Handfinish - 4-1-Assembly-B4B	5045482
D2965-3	Cap	2 pcs (1 ea)	260-Handfinish - 4-1-Assembly-B4B	F126369
D4686-1	Spacer	16 pcs (8 ea)	260-Handfinish - 4-1-Assembly-B4B	5045512
D5304-1	Crossbolt Spacer	4 pcs (2 ea)	260-Handfinish - 4-1-Assembly-B4B	5148278
MS20601-AD4W3	Rivet	64 Ea (32 ea)	260-Handfinish - 4-1-Assembly-B4B	5147502
NAS1149C0332R	Washer	10 Ea (5 ea)	260-Handfinish - 4-1-Assembly-B4B	5140516
D4753-1	Doubler	32 pcs (16 ea)	300-Packaging 3-1 - Stock - B4B	5078621

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
120-Skidtubes - 1	D4680-041-BENT	2	2	0
	D5520-1	4	28	0
170-Skidtubes - 2 - B4B	CR3212-5-05	136	0	0
	D4681-041	2	3	0
260-Handfinish - 4-1-Assembly-B4B	AELS-1032-130	6	100	0
	AN3C4A	6	2,555	0
	AN3C5A	4	1,104	0
	AN526C1032R10	4	71	0
	D2965	2	32	0
	D2965-3	2	12	0
	D4686-1	16	52	0
	D5304-1	4	51	0
	MS20601-AD4W3	64	552	0
	NAS1149C0332R	10	4,565	0
300-Packaging 3-1 - Stock - B4B	D4753-1	32	84	0

Part Specifications

Specifications could not be found.

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -041	P/N	DESCRIPTION
	X	D4680-041	SKIDTUBE
1	1	D2965	CAP
2	1	D2965-3	CAP
3	1	D4680-043	SKIDTUBE SUB ASSY
4	2	AN3C5A	BOLT
5	2	AN526C1032R10	SCREW
6	2	NAS1149C0332R	WASHER

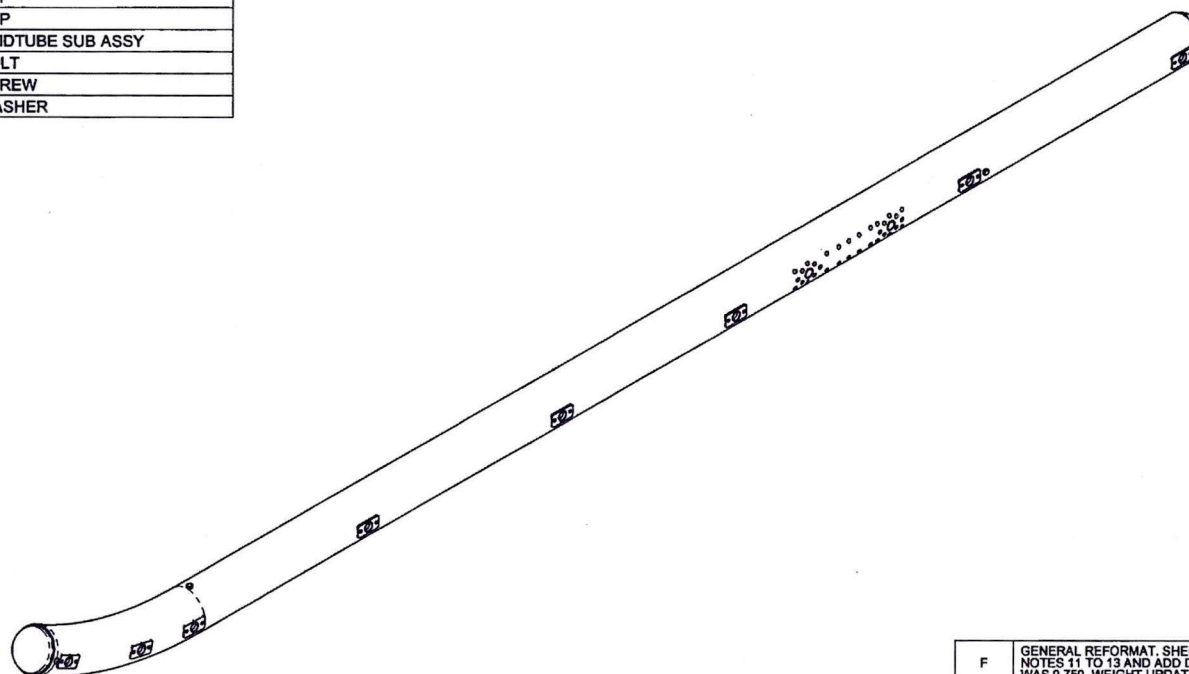

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 1.00 ABOVE CENTERLINE PER QSI 005 SECTION 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D4680-041" AND B/N PER QSI 044 METHOD 6.4 ON INNER RADIUS OF SKIDTUBE BEFORE INSTALLING D2965 CAP

- 7) WEIGHT: 19.3 lbs
- 8) SEAL FAYING SURFACES WITH SIKAFLEX -241/-291 OR PROSEAL 890/1422 OR MIL-S-8802 CLASS B-2 SEALANT
- 9) INSTALL FASTENERS WET WITH SIKAFLEX -241/-291 OR PROSEAL 890/1422 OR MIL-S-8802 CLASS B-2 SEALANT

RELEASED
2017-08-11
ECN 17-547

APPROVED

F	GENERAL REFORMAT. SHEET 3: ADD ITEMS 8 & 11 ADD NOTES 11 TO 13 AND ADD DETAIL H. SHEET 5: Ø0.188 WAS 0.750. WEIGHT UPDATE. ADD PROSEAL 1422	AJS	17.03.30
E	GROUND HANDLING CROSSBOLT SPACERS NOW SWAGED, WAS WELDED. REMOVED D3492-055 PLUG ASSEMBLIES	AP	15.11.02
D	MOVED AFT GROUNDING FASTENER HOLE AFT 0.25 DUE TO INTERFERENCE, ADDED NOTE 9 (SHT 1), GROUNDING STRAP WASHERS NOW STAINLESS	AP	15.03.04
C	NAS1149P0332P WAS AN960-10L, AN526C1032R10 WAS AN526C1032-10, FWD GROUNDING STRAP FASTENER MOVED AFT (C5-3), Ø0.750 WAS Ø0.758 (B4-3).	AP	14.07.29
B	FWD CAP WAS D2965 NOW D2965-3, VARIOUS DIMENSIONAL CHANGES. D3492-055 PLUG ASSY WAS D3492-051, SWAGING DIMENSION NOW 0.650 WAS 0.661 (D6-2), ADDED DETAIL H (C2-3). MATERIAL D2962-150 WAS D2962-131 (A7-3). GROUND HANDLING THRU HOLES NOW WELDED, ADDED SECTION G-G (D3-2)	AP	13.09.10
A	NEW ISSUE	AP	13.02.13
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	AJS		
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 1 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

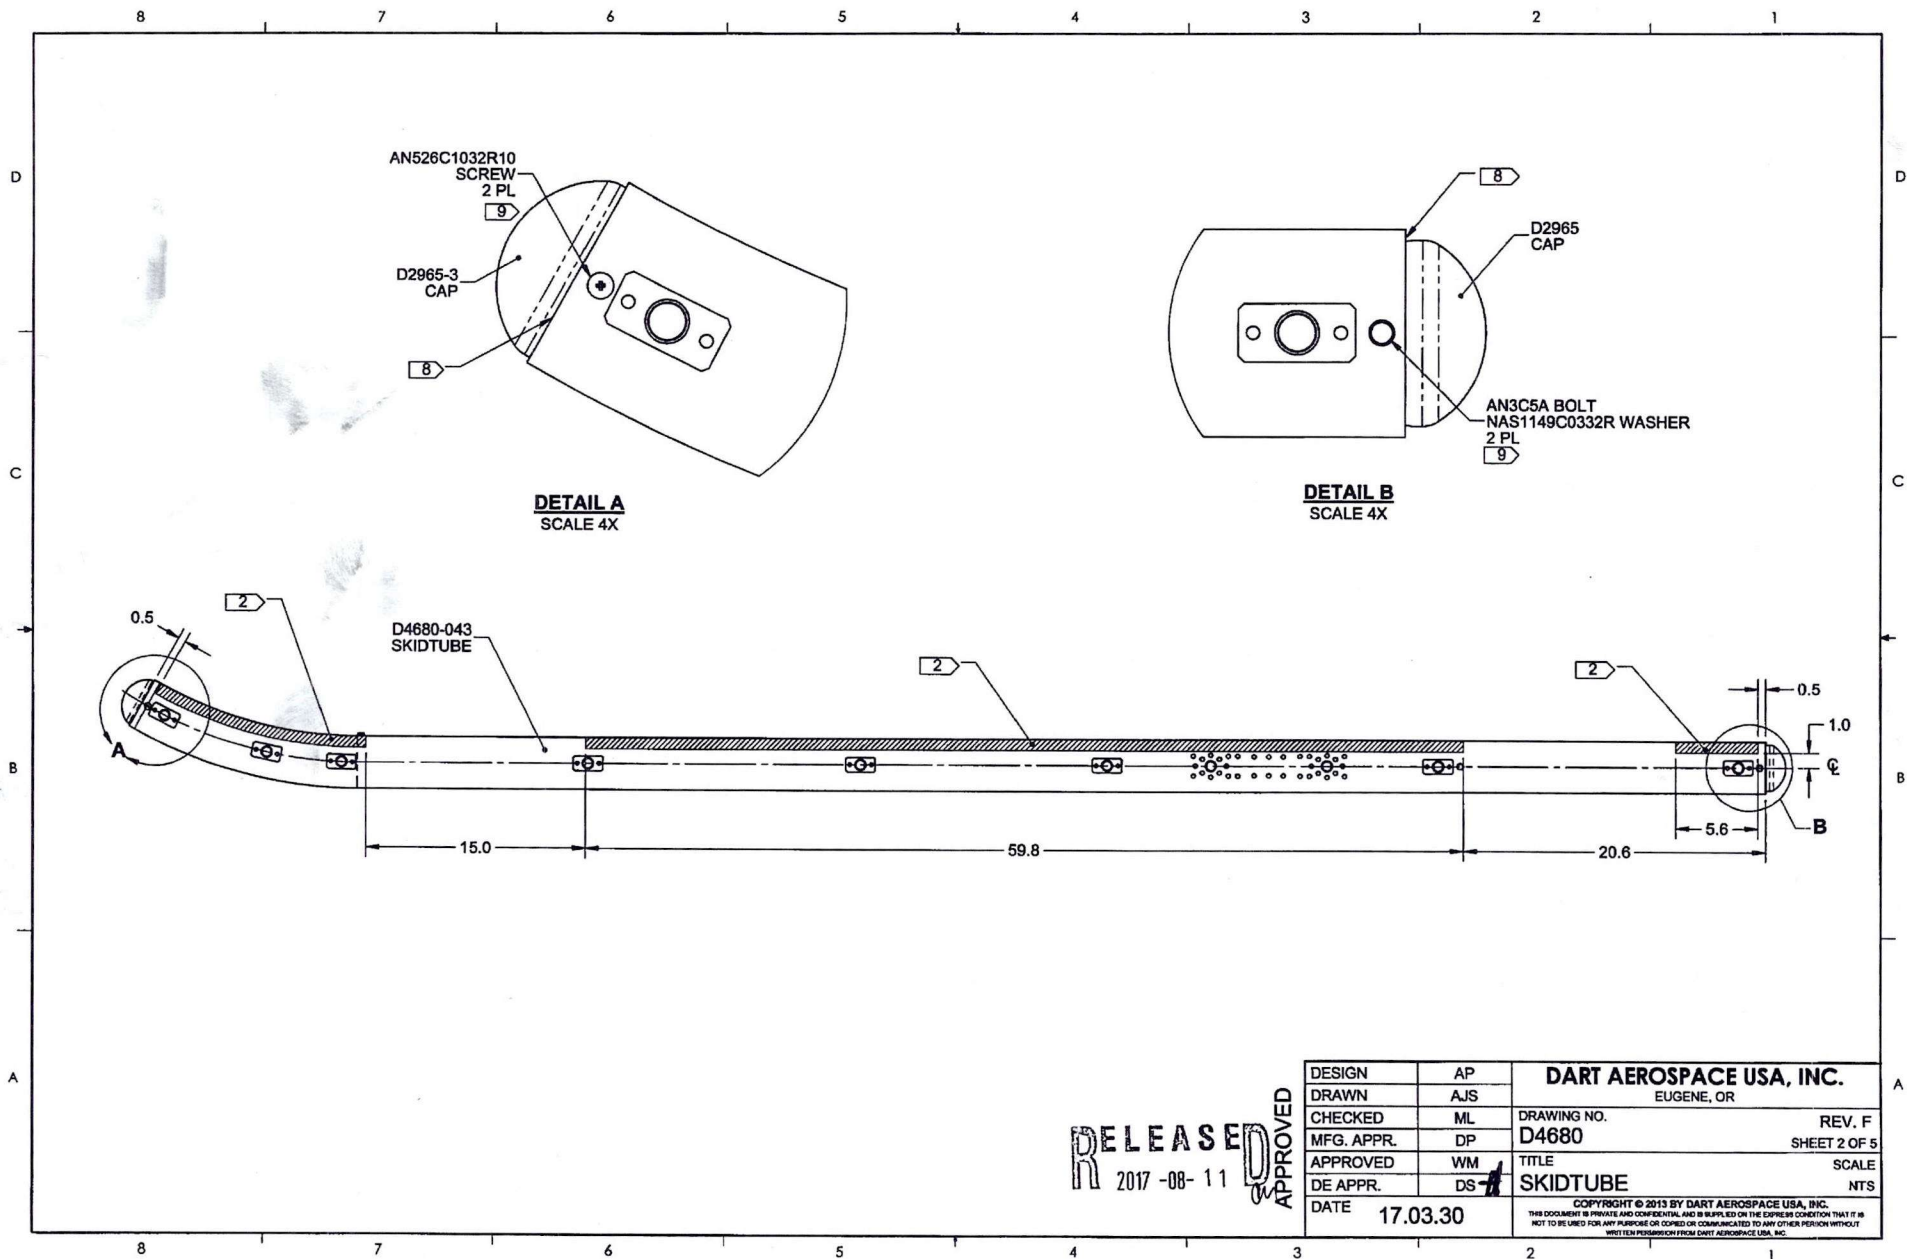

RELEASED
2017-08-11

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	AJS		
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 2 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -043	P/N	DESCRIPTION
	X	D4680-043	SKIDTUBE SUB ASSY
1	1	D4680-1	SKIDTUBE
2	1	D4681-041	WEB ASSY
3	8	D4686-1	SPACER
4	16	D4753-1	DOUBLER
5	2	D5304-1	CROSSBOLT SPACER
6	2	D5520-1	DOUBLER
7	3	AN3C4A	BOLT
8	32	MS20601AD4W3	RIVET, BLIND, CSK
9	3	NAS1149C0332R	WASHER
10	3	AELS-1032-130	INSERT
11	68	CR3212-5-05	CSK RIVET, CHERRY MAX


OPEN TO
Ø0.750
THRU 2 PL

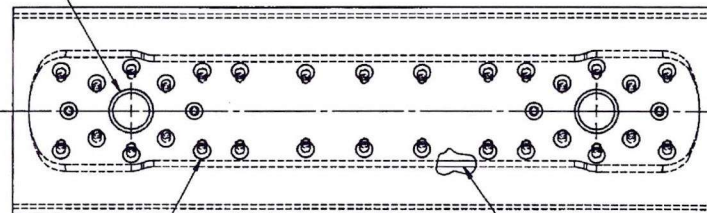

13 12 CR3212-5-05
CSK RIVET, CHERRY MAX
34 PL PER DOUBLER

DETAIL H
SCALE 4X

11 D5520-1 DOUBLER
2 PL

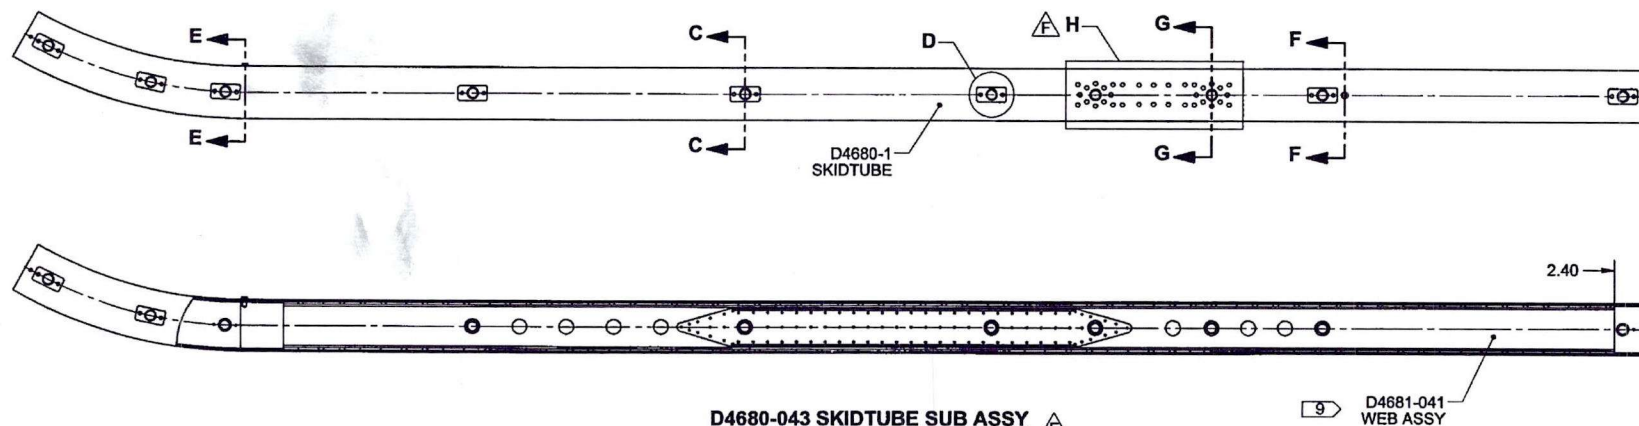

D4680-043 SKIDTUBE SUB ASSY

9 D4681-041
WEB ASSY

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: APPLY CHEMICAL CONVERSION COATING PER DART QSI 005 4.1 PRIOR TO INSTALLING D4681-041 WEB.
POWDER COAT WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 18.6 lbs
- 8) SEAL ALL MATING SURFACES USING PROSEAL 890/1422 OR MIL-S-8802 CLASS B2 SEALANT
- 9) INSERT D4681-041 WEB INTO D4680-1 SKIDTUBE IN LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX -241/-291 ADHESIVE PER DART QSI 015
- 10) INSTALL D4686-1 SPACER AFTER INSTALLING D4753-1 DOUBLERS
- 11) LOCATE THE D5520-1 DOUBLER USING THE Ø0.188 PILOT HOLES ON THE SKIDTUBE AND DOUBLER
- 12) LOCATE QTY (34) HOLES ONTO THE SKIDTUBE PER D5520-1 DOUBLER AND DRILL Ø0.161 THRU SKIDTUBE AND DOUBLER USING DT10309
- 13) COUNTERSINK THE SKIDTUBE Ø0.286 X 100° (34 PL) AND INSTALL EACH D5520-1 DOUBLER USING QTY (34) CR3212-5-05 CSK RIVETS

RELEASED
2017-08-11

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	AJS		
CHECKED	ML	DRAWING NO. D4680	REV. F
MFG. APPR.	DP		SHEET 3 OF 5
APPROVED	WM	TITLE SKIDTUBE	SCALE NTS
DE APPR.	DS		
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐


Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

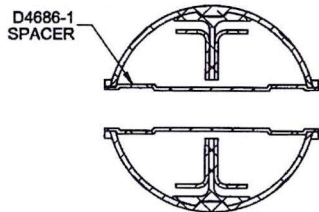

10 SECTION C-C
SCALE 4X
8 PL

INSTALL D4686-1 SPACER AS FOLLOWS (8 PL)
AFTER INSTALLING D4753-1 DOUBLERS PER DETAIL D

1. INSERT D4686-1 SPACER
2. SWAGE TO $\phi 0.650 +0.010/-0.000$ X 1.0
DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

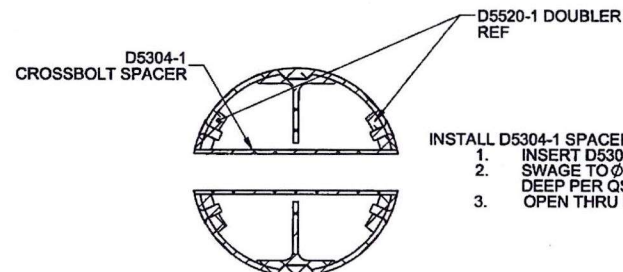


SECTION G-G
SCALE 4X
2 PL

INSTALL D5304-1 SPACER AS FOLLOWS (2 PL)


1. INSERT D5304-1 SPACER
2. SWAGE TO $\phi 0.565 +0.005/-0.000$ X 1.0
DEEP PER QSI 002
3. OPEN THRU HOLE TO $\phi 0.625$

8
D4753-1
DOUBLER

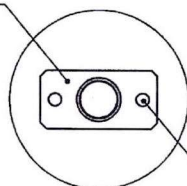


DETAIL D
16 PL (BOTH SIDES)
SCALE 4X

MS20601AD4W3
RIVET, BLIND, CSK
2 PL

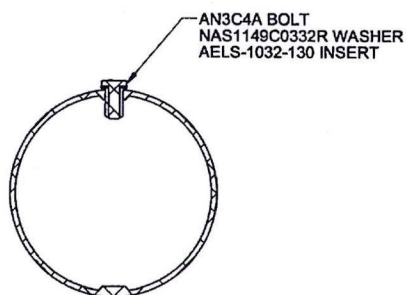

SECTION E-E
SCALE 4X

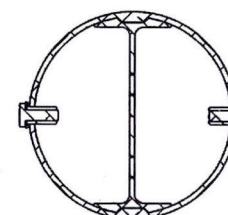

SECTION F-F
SCALE 4X

AN3C4A BOLT
NAS1149C0332R WASHER
AELS-1032-130 INSERT
2 PL

RELEASED
2017-08-11

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	AJS		
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 4 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS			
		Skid-tube ☐ Machining ☐ Large Fab ☐	Cross tube ☐ Small Fab ☐ Finishing ☐	Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐	Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐
Date :	Sequence #:	QTY Affected :			MRB (QSI042)
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor
					QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY			
		☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled	☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function	☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up	☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread
		Other/Details:			

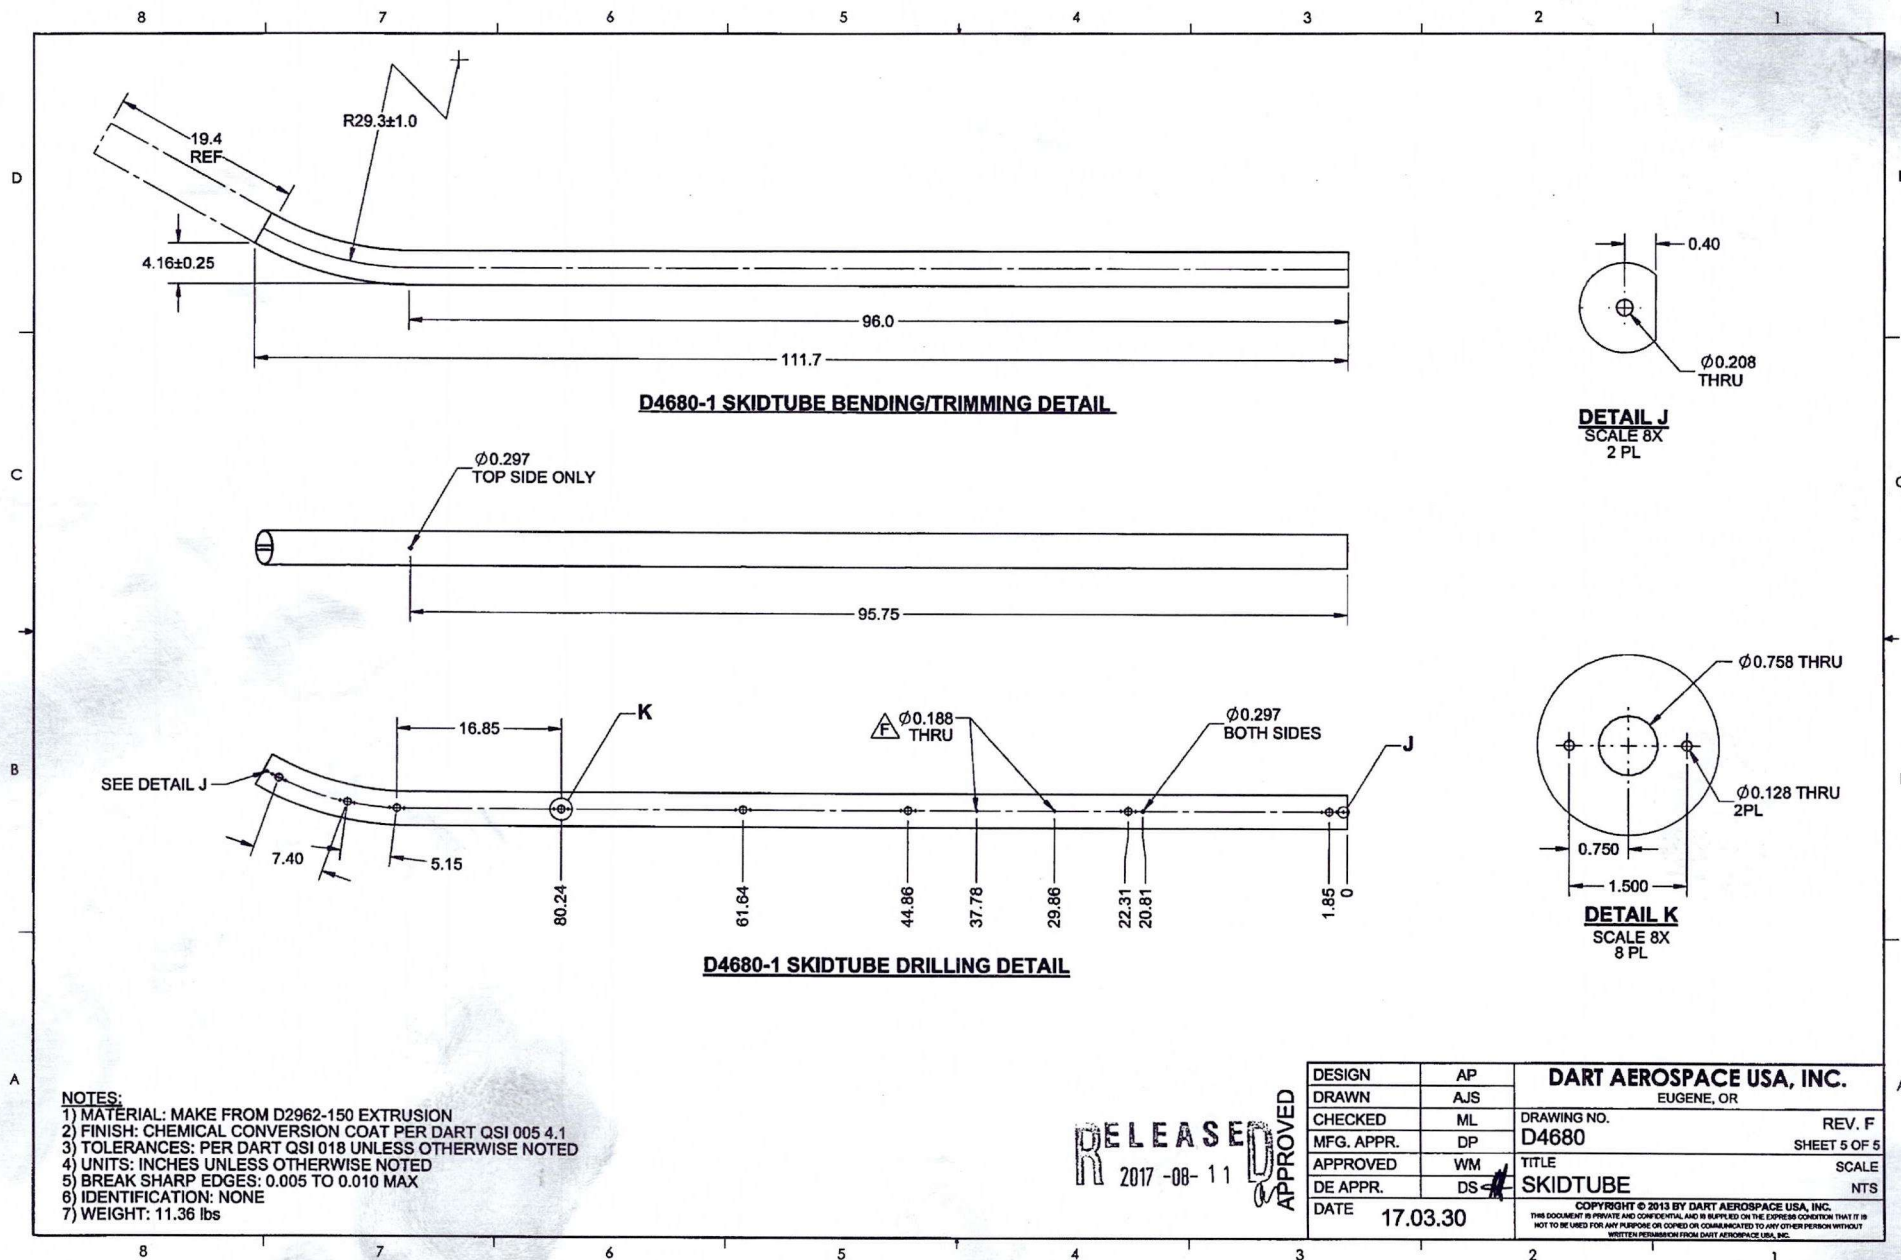

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details: _____					